


Setting detail of HIT-TZ / HIT-RTZ

Installation Temperature:

+5°C...41°F / 40°C...104°F

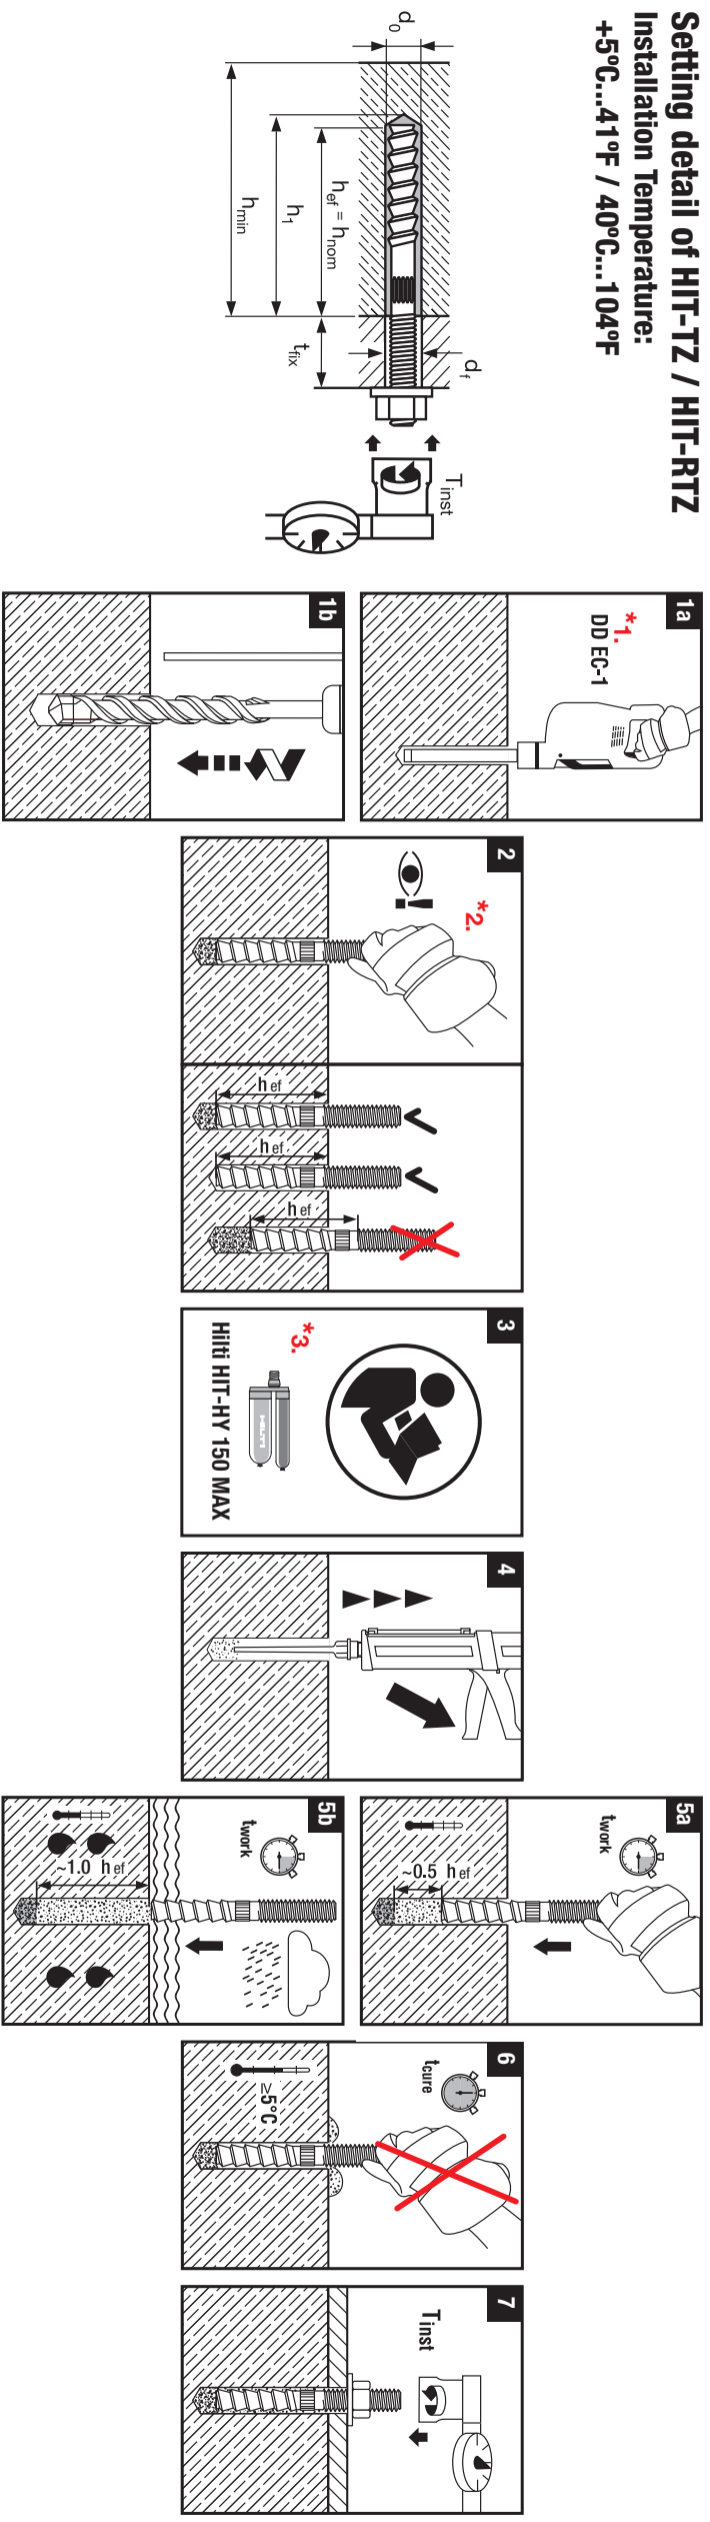

Metric Sizes

Ø d	t _{fix} [mm]	d ₀ [mm]	h ₁ [mm]	h _{ef} [mm]	d _r [mm]	D _r [mm]	h _{min} [mm]	T _{inst} [Nm]
M8 x 55/fix	15/25/40	10	60	55	9	12	110	12
M10 x 65/fix	15/25/40/60	12	70	65	12	14	130	23
M12 x 75/fix	15/30/50/75/100	14	80	75	14	16	150	40
M16 x 90/fix	25/60/100	18	95	90	18	20	180	70
M20 x 120/fix	30/60	22	125	120	22	24	240	130


Inch Sizes

Ø d	t _{fix} [mm]	d ₀ [mm]	h ₁ [mm]	h _{ef} [mm]	d _r [mm]	D _r [mm]	h _{min} [mm]	T _{inst} [ft.lb.]
3/8"	1 [25]	7/16 [12]	3 1/4 [82]	2 7/8 [73]	-	-	3 3/4 [95]	15 [20]
1/2"	1 1/2 [37]	9/16 [14]	4 [102]	3 1/2 [89]	-	-	5 1/4 [135]	20 [28]
5/8"	2 1/4 [56]	1 1/16 [18]	4 1/4 [109]	4 [102]	-	-	6 [150]	50 [65]
3/4"	4 1/16 [103]	13/16 [22]	5 1/16 [129]	5 1/4 [133]	-	-	7 7/8 [200]	105 [140]

Setting detail of HIT-TZ / HIT-RTZ

Installation Temperature:

+5°C...41°F / 40°C...104°F

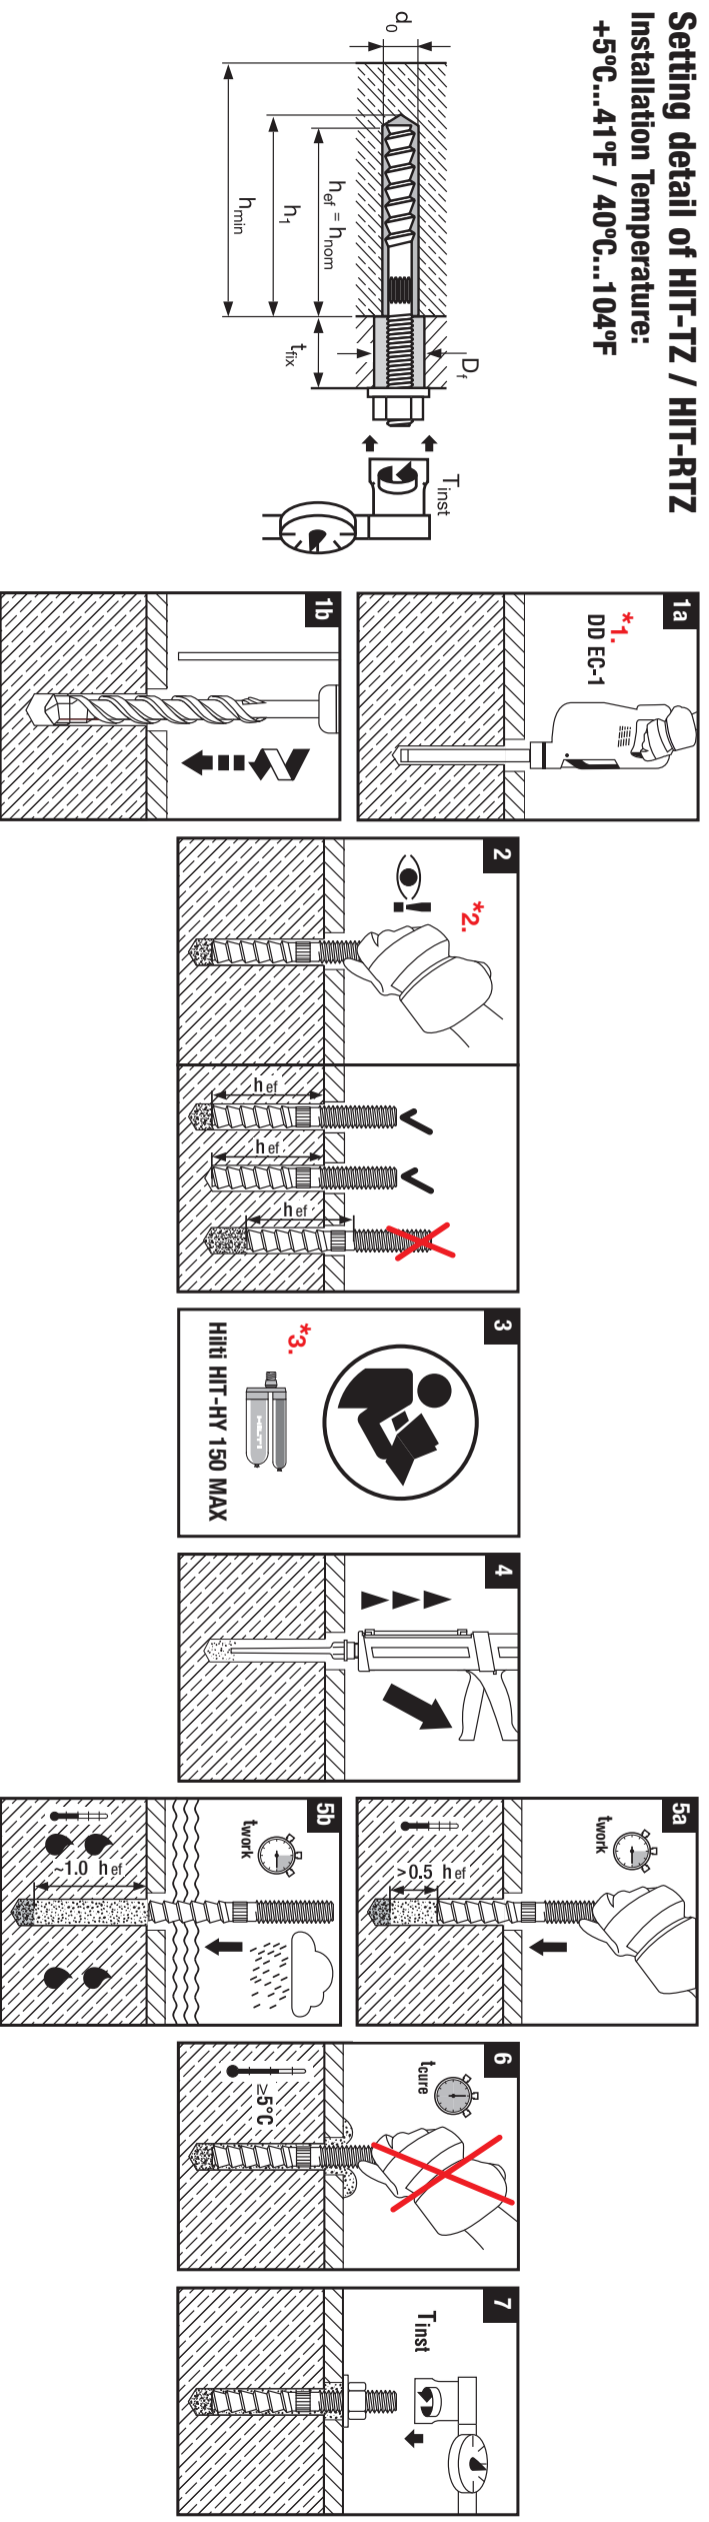

Temperature [°C]	Temperature [°F]	t _{hook}	t _{hook}	t _{hook}
5...20	41...68	0..8 min	0..5 min	≥1 h
21...30	69...86	0..5 min	0..2 min	≥30 min
31...40	87...110	0..2 min	0..2 min	≥30 min

